

Release Note for Vigor2710 Series

Firmware Version: 3.3.2.3

Built Date: March 17, 2010

Applied Models:

Vigor2710, Vigor2710n, Vigor2710Vn, Vigor2710VDn

- File and Modem Code

(1)For Annex A Model,

- " v2710_a_3323" is used for modem code 211011. (Standard)
- " v2710_a1_3323" is used for modem code 211801.
- " v2710_a2_3323" is used for modem code 2121501.
- " v2710_a3_3323" is used for modem code 2211201.
- " v2710_a4_3323" is used for modem code 232201. (Recommended for UK – SEG)

(2)For Annex B Model,

- " v2710_b_3323" is used for modem code 2111112. (Standard)
- " v2710_b1_3323" is used for modem code 2111302. (Recommended for Attel Czech only)
- " v2710_b2_3323" is used for modem code 2121302.
- " v2710_b4_3323" is used for modem code 214702.
- " v2710_b5_3323" is used for modem code 2111312.
- " v2710_b6_3323" is used for modem code 215202.

New Features

- Support Vigor ACS SI.

Improvement

- Corrected: Phone 1 and Phone 2 connect with remote Internet phones. When a new call comes from PSTN line and the user of Phone 2 hangs up to pick that phone, the device reboots immediately.
- Corrected: The router reboots while carrying out two consecutive Call Transfers.
- Corrected: System reboot occurs when make a DECT internal call phone or receive incoming call.
- Corrected: PPTP pass-through can not work.

- Corrected: Got buffer leakage problem when the router registered on some SIP servers.
- Corrected: Java Script error on WUI when keying the character of (") for IPSec Pre-share key.
- Improved: Met SIP register expire time problem. The proxy server sends two different expire time, however we choose the global one.
- Improved: Display error message for username or password in login page.

Known Issue

- None

Notes

Modifications

- None